


## Mouse IL-2 ELISA Ready-SET-Go!®

**Catalog Number:** 88-7024

**Also Known As:** Interleukin-2

**RUO:** For Research Use Only. Not for use in diagnostic procedures.

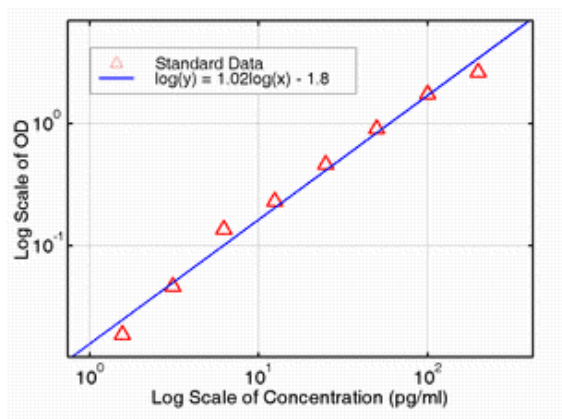

Standard curve of Mouse IL-2 ELISA Ready-SET-Go!®

### Product Information

**Contents:** Mouse IL-2 ELISA Ready-SET-Go!®

**REF** **Catalog Number:** 88-7024

**Sensitivity:** 2 pg/mL

**Standard Curve Range:** 2 - 200 pg/mL



**Temperature Limitation:** Store at 2-8°C except standard which should be stored at less than or equal to -70°C.



**Batch Code:** Refer to Vial



**Use By:** Refer to Vial

### Description

This Mouse IL-2 ELISA Ready-SET-Go! reagent set (with or without high-affinity binding microwell plates) contains the necessary reagents, buffers and diluents for performing quantitative enzyme linked immunosorbent assays (ELISA). This ELISA reagent set is specifically engineered for accurate and precise measurement of mouse IL-2 protein levels from samples including serum, and supernatants from cell cultures.

### Components

**Capture Antibody.** Pre-titrated, purified antibody

**Detection Antibody.** Pre-titrated, biotin-conjugated antibody

**Standard.** Recombinant cytokine for generating standard curve and calibrating samples

**ELISA/ELISPOT Coating Buffer Powder.** This Ready-Set-Go! ELISA Set may contain ELISA/ELISPOT Coating Buffer Powder (Reconstitute to 1L with dH2O and filter (0.22 µm)) or 10X PBS ELISA Coating Buffer (Dilute 1 part 10X Buffer into 9 parts dH2O).

**Assay Diluent.** 5X concentrated

**Detection enzyme.** Pre-titrated Avidin-HRP

**Substrate Solution.** Tetramethylbenzidine (TMB) Substrate Solution

**Certificate of Analysis.** Lot-specific instructions for dilution of antibodies and standards

**96 Well Plate.** Corning Costar 9018 (included with product Cat. #'s ending in suffixes -22, -44, -76, -86)

### References

Nakano T, Araki K, et al. 2007. Effects of geldanamycin and thalidomide on the Th1/Th2 cytokine balance in mice subjected to operative trauma. *Surgery* 141(4):490-500. (RSG ELISA kit, **serum**, PubMed)

Zhang C, Zou X, et al. 2007. Immune tolerance induced by adoptive transfer of dendritic cells in an insulin-dependent diabetes mellitus murine model. *Acta Pharmacol Sin.* 28(1):98-104. (RSG ELISA kit, **serum**, PubMed)

Hadzic T, Li L, et al. 2005. The role of low molecular weight thiols in T lymphocyte proliferation and IL-2 secretion. *J Immunol.* 175(12):7965-72. (RSG ELISA kit, **TC supernatant**, PubMed)

Chaitra MG, Nayak R, and Shaila MS. 2007. Modulation of immune responses in mice to recombinant antigens from PE and PPE families of proteins of *Mycobacterium tuberculosis* by the Ribi adjuvant. *Vaccine.* 25(41):7168-76. (RSG ELISA kit, **TC supernatant**, PubMed)

### Related Products

88-7121 Mouse IL-12 p70 ELISA Ready-SET-Go!®

88-7234 Mouse IL-23 ELISA Ready-SET-Go!® (Discontinued: Please see 88-7230 (2nd generation assay))

---

Not for further distribution without written consent.

Copyright © 2000-2012 eBioscience, Inc.

Tel: 888.999.1371 or 858.642.2058 • Fax: 858.642.2046 • [www.eBioscience.com](http://www.eBioscience.com) • [info@eBioscience.com](mailto:info@eBioscience.com)

---

## Enzyme Linked Immunosorbent Assay (ELISA)

### Research Use Only

---

#### Protocol: ELISA Ready-Set-Go!

---

The following protocol is a general guideline for the Ready-SET-Go! Sets

##### Materials Provided

- Please refer to the Certificate of Analysis (C of A) for components

##### Other Materials Needed

- Buffers\*
  - Wash Buffer: 1x PBS, 0.05% Tween-20 (or eBioscience ELISA Wash Buffer Powder, Cat. No. 00-0400)
  - Stop Solution: 1M H<sub>3</sub>PO<sub>4</sub> (recommended) or 2N H<sub>2</sub>SO<sub>4</sub>
- Pipettes
- Refrigerator & frost-free -20°C freezer
- 96-well plate (Corning Costar 9018 or NUNC Maxisorp®)  
**NOTE: The use of ELISA plates which are not high affinity protein binding plates will result in suboptimal performance, e.g., low signal or inconsistent data. Do not use tissue culture plates or low protein absorption plates. Use only the Corning Costar 9018 or NUNC Maxisorp (Cat. No. 44-2404) 96-well plates**
- 96-well ELISA plate reader (microplate spectrophotometer)
- ELISA plate washer (highly recommended)

**NOTE: To ensure optimal results from this ELISA Ready-SET-Go! Set, please only use the components included in the set. Exchanging of components is not recommended as a change in signal may occur.**

##### Time Requirements

- 1 overnight incubation
- 4½-hour incubations
- 1 hour washing and analyzing samples

##### Experimental Procedure

1. Coat Corning Costar 9018 (or Nunc Maxisorp®) ELISA plate with 100 µL/well of capture antibody in Coating Buffer (dilute as noted on C of A, which is included with the reagent set). Seal the plate and incubate overnight at 4°C.
2. Aspirate wells and wash 3 times with >250 µL/well Wash Buffer\*. Allowing time for soaking (~1 minute) during each wash step increases the effectiveness of the washes. Blot plate on absorbent paper to remove any residual buffer.
3. Dilute 1 part 5X concentrated Assay Diluent with 4 parts DI water.\* Block wells with 200 µL/well of 1X Assay Diluent. Incubate at room temperature for 1 hour.
4. Optional: Aspirate and wash at least once with Wash Buffer.
5. Using 1X Assay Diluent\*, dilute standards as noted on the C of A to prepare the top concentration of the standard. Add 100 µL/well of top standard concentration to the appropriate

---

## Enzyme Linked Immunosorbent Assay (ELISA)

### Research Use Only

wells. Perform 2-fold serial dilutions of the top standards to make the standard curve for a total of 8 points. Add 100 µL/well of your samples to the appropriate wells. Seal the plate and incubate at room temperature for 2 hours (or overnight at 4°C for maximal sensitivity).

6. Aspirate/wash as in step 2. Repeat for a total of 3-5 washes\*\*.
7. Add 100 µL/well of detection antibody diluted in 1X Assay Diluent\* (dilute as noted on C of A). Seal the plate and incubate at room temperature for 1 hour.
8. Aspirate/wash as in step 2. Repeat for a total of 3-5 washes\*\*.
9. Add 100 µL/well of Avidin-HRP\* diluted in 1X Assay Diluent (dilute as noted on C of A). Seal the plate and incubate at room temperature for 30 minutes.
10. Aspirate and wash as in step 2. In this wash step, soak wells in Wash Buffer\* for 1 to 2 minutes prior to aspiration. Repeat for a total of 5-7 washes\*\*.
11. Add 100 µL/well of Substrate Solution to each well. Incubate plate at room temperature for 15 minutes.
12. Add 50 µL of Stop Solution to each well.
13. Read plate at 450 nm. If wavelength subtraction is available, subtract the values of 570 nm from those of 450 nm and analyze data.

#### **NOTES:**

**\* Be certain that no sodium azide is present in the solutions used in this assay, as this inhibits HRP enzyme activity.**

**\*\*The number of washes in the protocol was adapted to an automatic plate washer. This can be decreased when using other methods but should be tested empirically. Allowing time for soaking (~ 1 minute) during each wash step increases the effectiveness of the washes.**

## Enzyme Linked Immunosorbent Assay (ELISA)

### Research Use Only

#### Quick Guide: Standard Calibration

The following table indicates the protein standard contained in the Ready-SET-Go! is calibrated against NIBSC standards.

| Table of Standard Calibration |                   |                      |                     |              |
|-------------------------------|-------------------|----------------------|---------------------|--------------|
| Cytokine                      | ng of eB standard | ng of NIBSC standard | U of NIBSC standard | NIBSC Lot #  |
| hIL-2                         | 1                 | 1.1                  | 14.6                | 86/564       |
| hIL-4                         | 1                 | 2.2                  | 22                  | 88/656       |
| hIL-5                         | 1                 | 2.2                  | 22                  | 90/586       |
| hIL-6                         | 1                 | 1.7                  | 170                 | 89/548       |
| hIL-8                         | 1                 | 1.8                  | 180                 | 89/520       |
| hIL-10                        | 1                 | 0.8                  | 4                   | 93/722       |
| hIL-12                        | 1                 | 0.8                  | 8                   | 95/544       |
| hIL-17A                       | 1                 | 0.9                  | 9000                | 01/420       |
| hIFN-g                        | 1                 | 1.1                  | 22                  | 87/586       |
| hTNF-a                        | 1                 | 0.9                  | 36                  | 87/650       |
| mIL-2                         | 1                 | 3.1                  | 310                 | 93/566       |
| mIL-4                         | 1                 | 3                    | 30                  | 91/656       |
| mIL-6                         | 1                 | 8.5                  | 850                 | 93/730       |
| mIFN-g*                       | 1                 |                      | 4.5                 | Gg02-901-533 |
| mTNF-a                        | 1                 | 1.7                  | 340                 | 88/532       |

\* Mouse IFN-g is calibrated using NIH standard (Lot Gg02-901-533) and is measured in Units (U)

#### ELISA Troubleshooting Guide

| Problem            | Possibility                                                                                                                     | Solution                                                                                          |
|--------------------|---------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------|
| A. High background | 1. Improper and inefficient washing                                                                                             | 1. Improve efficiency of washing. Fill plates completely, soak for 1 minute per wash, as directed |
|                    | 2. Cross contamination from other specimens or positive control                                                                 | 2. Repeat ELISA being careful when washing and pipetting                                          |
|                    | 3. Contaminated substrate                                                                                                       | 3. Substrate should be colorless. Replace                                                         |
|                    | 4. Incorrect dilutions, e.g., conjugate concentration was too high                                                              | 4. Repeat using correct dilutions                                                                 |
| B. No signal       | 1. Improper, low protein binding capacity plates were used                                                                      | 1. Repeat ELISA using recommended high binding capacity plates                                    |
|                    | 2. Wrong substrate was used                                                                                                     | 2. Repeat ELISA using the correct substrate                                                       |
|                    | 3. Enzyme inhibitor present in buffers; e.g., sodium azide in the washing buffer and Assay Diluent inhibits peroxidase activity | 3. Repeat ELISA making no enzyme inhibitor is present in any buffers.                             |

Not for further distribution without written consent.

Copyright © 2000-2012 eBioscience, Inc.

Tel: 888.999.1371 or 858.642.2058 • Fax: 858.642.2046 • [www.ebioscience.com](http://www.ebioscience.com) •  
[info@ebioscience.com](mailto:info@ebioscience.com)

## Enzyme Linked Immunosorbent Assay (ELISA)

### Research Use Only

|                                 |                                                                        |                                                                                                                                                                               |
|---------------------------------|------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|                                 | 4. Coated capture antibody in Assay Diluent rather than Coating Buffer | 4. Repeat ELISA using Coating Buffer contained in the set as the diluent for the capture antibody.                                                                            |
| C. Very weak signal             | 1. Improper and inefficient washing                                    | 1. Make sure washing procedure is done correctly, with a soak time.                                                                                                           |
|                                 | 2. Incorrect dilutions of standard                                     | 2. Follow recommendations of standard preparation exactly as written on the C of A                                                                                            |
|                                 | 3. Insufficient incubation time                                        | 3. Repeat ELISA following the protocol carefully for each step                                                                                                                |
|                                 | 4. Incorrect storage of reagents                                       | 4. Store reagents at the correct temperature as indicated on the Technical Data Sheet. Freezing certain components will severely impact results. Do not re-use the standards. |
|                                 | 5. Wrong filter in ELISA reader was used                               | 5. Use the correct wavelength setting                                                                                                                                         |
|                                 | 6. Wrong plate used                                                    | 6. Use the recommended Corning Costar 9018 or NUNC Maxisorp flat bottom 96 well plates                                                                                        |
| D. Variation amongst replicates | 1. Improper and inefficient washing                                    | 1. Make sure washing procedure is done correctly; see C of A. Edge effects can be avoided by moving samples and standards in from the edge of the plate.                      |
|                                 | 2. Poor mixing of samples                                              | 2. Mix samples and reagents gently and equilibrate to proper temperature                                                                                                      |
|                                 | 3. Plates not clean                                                    | 3. Plates should be wiped on bottom before measuring absorbance                                                                                                               |
|                                 | 4. Reagents have expired                                               | 4. Order a new Ready-Set-Go ELISA.                                                                                                                                            |